

MARTIN COUNTY: SH 349

5,200 ft. South of CR 3200 to 400 ft. North of CR 3200

Existing Conditions

» Narrow shoulders


» Sight distance issues from CR 3200

» Horizontal curve immediately after corridor ends


Crash Summary

36	Total Crashes	0	Pedestrian Crashes
5	Fatal Crashes	0	Bicyclist Crashes
7	Suspected Serious Injury Crashes	5	Intersection Related Crashes
10	Suspected Minor Injury Crashes		

Contributing Factors

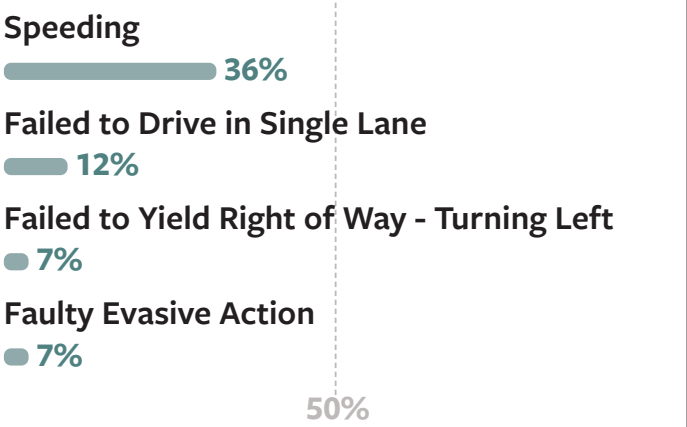

Manners of Collision

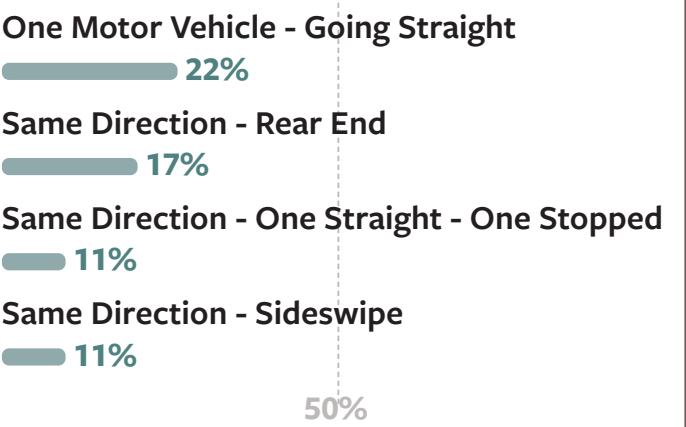

Safety Emphasis Areas

Roadway & Lane Departures

Distracted Driving

Impaired Driving

Intersection Safety

Occupant Protection

Speed Related

Vulnerable Road Users

Martin County: SH 349

This section of SH 349 is located in an area with a high number of oil field leading to a large volume of heavy trucks. Near the end of the corridor at the CR 3200 intersection there is a Water Company and small restaurant. The corridor is classified as an “Other Principal Arterial” with a speed limit of 75 MPH. Additionally, SH 349 is 4-lanes and undivided.

Corridor Recommendations

Targeted Enforcement

Widen Paved Shoulders

Appropriate Speed

Lighting

